

Task	Class	1	Structure
Project No.	2007-4990		
Date	18 DECEMBER 2008		
Drawn	FVP		
Checked	TJM		
Scale	AS NOTED		
EAST ELEVATION			
Sheet No.	A101		
Printer No.			

Project:
BALTIMORE COUNTY PUBLIC
SAFETY HEADQUARTERS
700 EAST JOPPA ROAD
TOWSON MD 21204

Consultant:

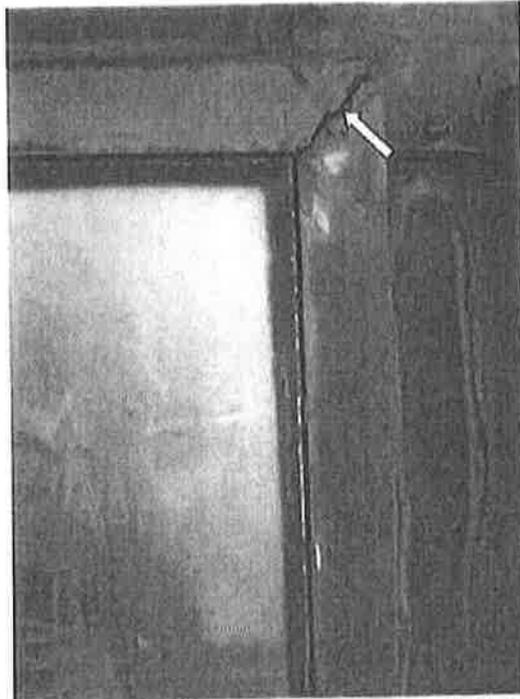


Figure No. 28: Separation of the framing members at a mitered corner

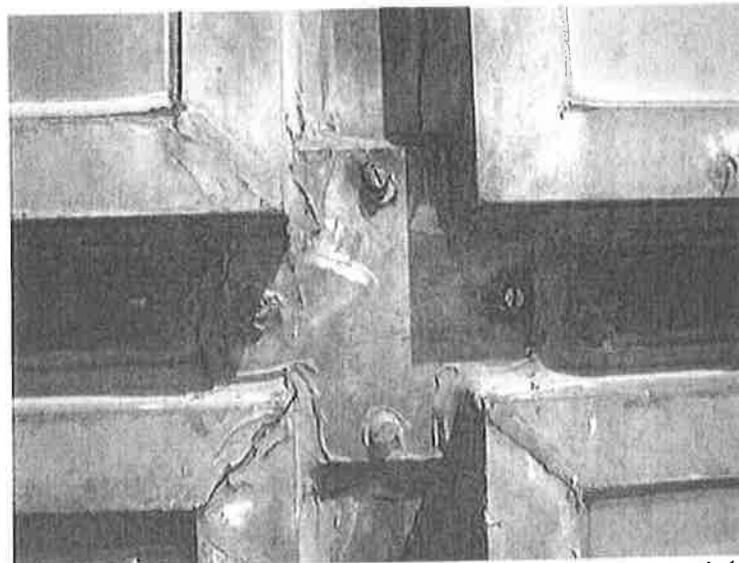


Figure No. 29: Silicone sealant fillet and bridge seals around the extruded aluminum closure and retrofit splice plates between curtain wall extrusions and across frame joinery

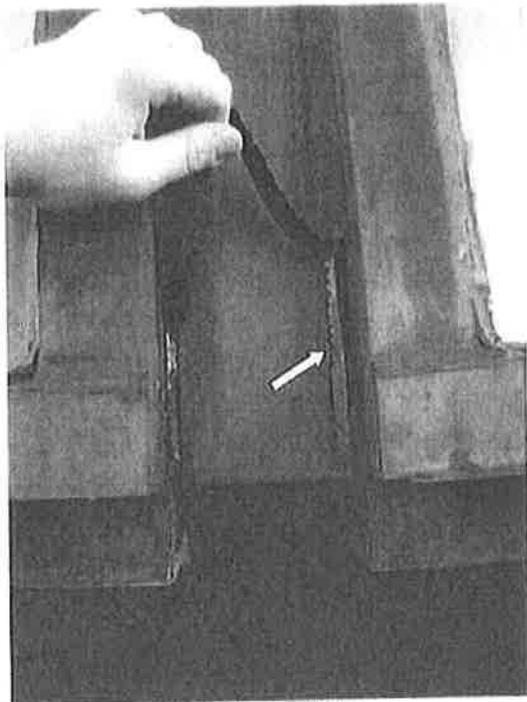


Figure No. 31: Failure of the exterior joint sealant due to misplaced bond breaker tape